


SYSTEM WIRING DIAGRAMS Cooling Fan Circuit

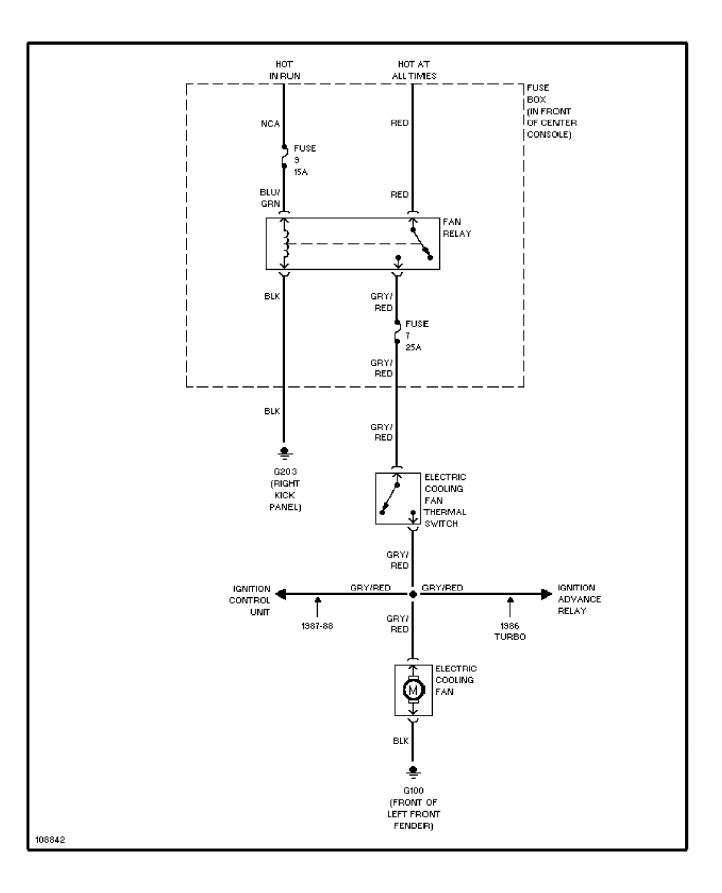


SYSTEM WIRING DIAGRAMS Starting Circuit

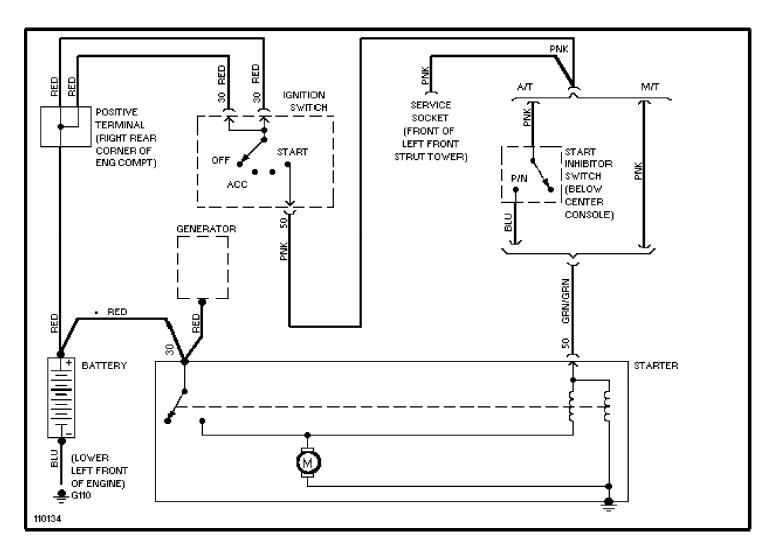


SYSTEM WIRING DIAGRAMS Front Wiper/Washer Circuit

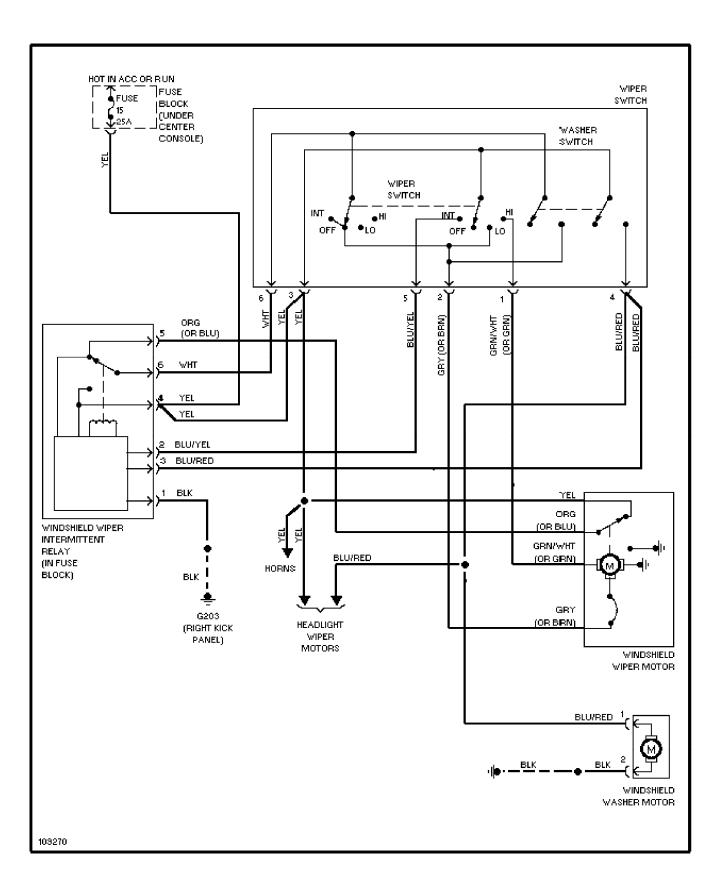


SYSTEM WIRING DIAGRAMS Rear Wiper/Washer Circuit

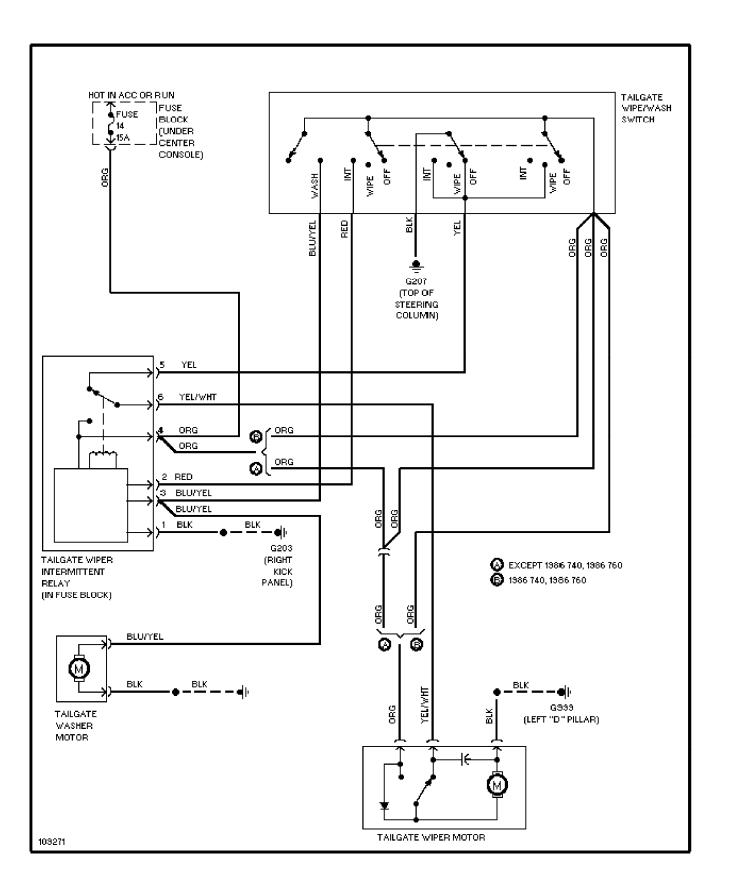


SYSTEM WIRING DIAGRAMS Defogger Circuit

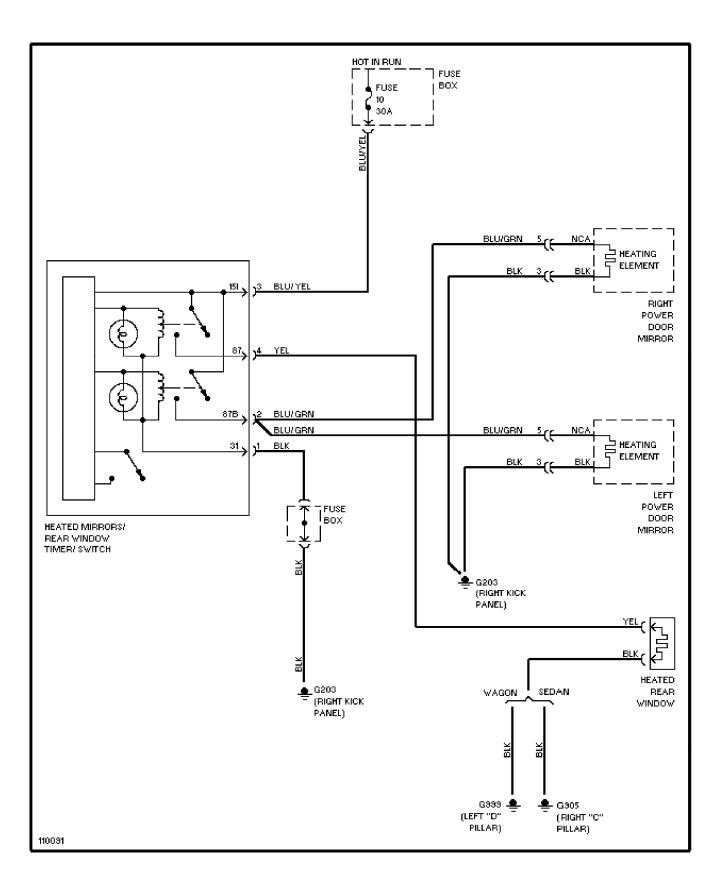


SYSTEM WIRING DIAGRAMS Horn Circuit

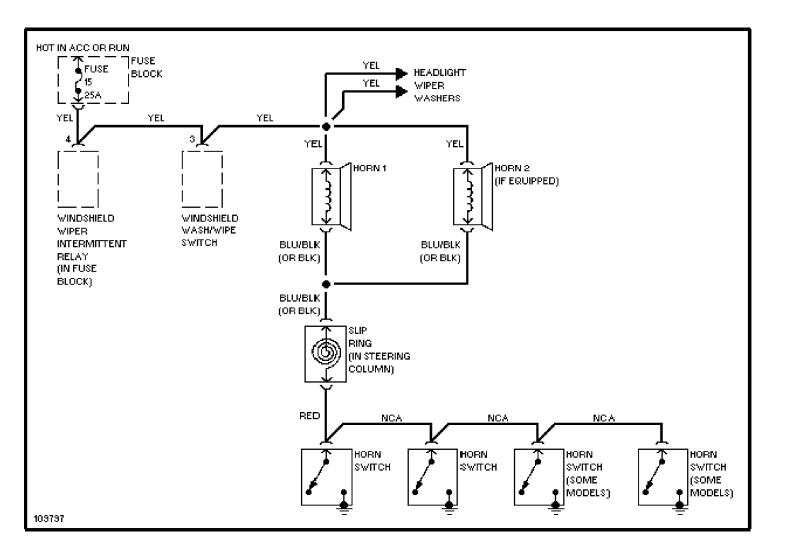


SYSTEM WIRING DIAGRAMS Power Antenna Circuit

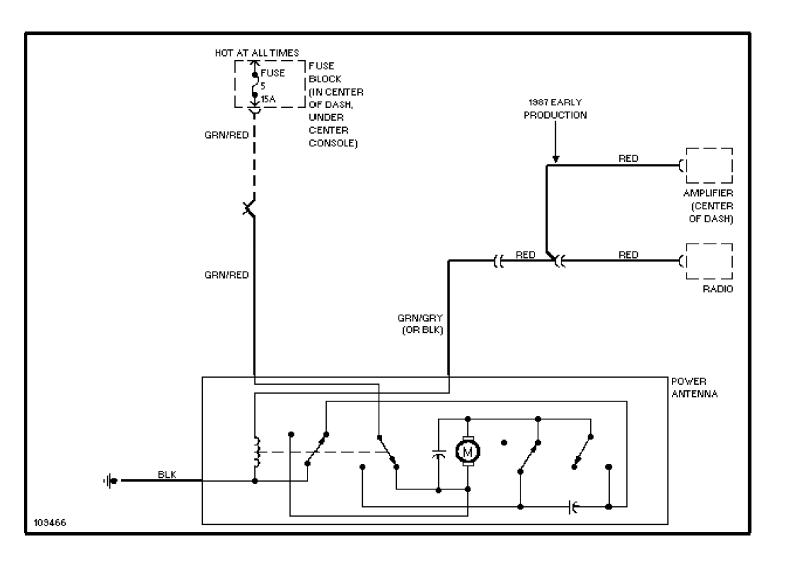


SYSTEM WIRING DIAGRAMS Power Door Lock Circuit

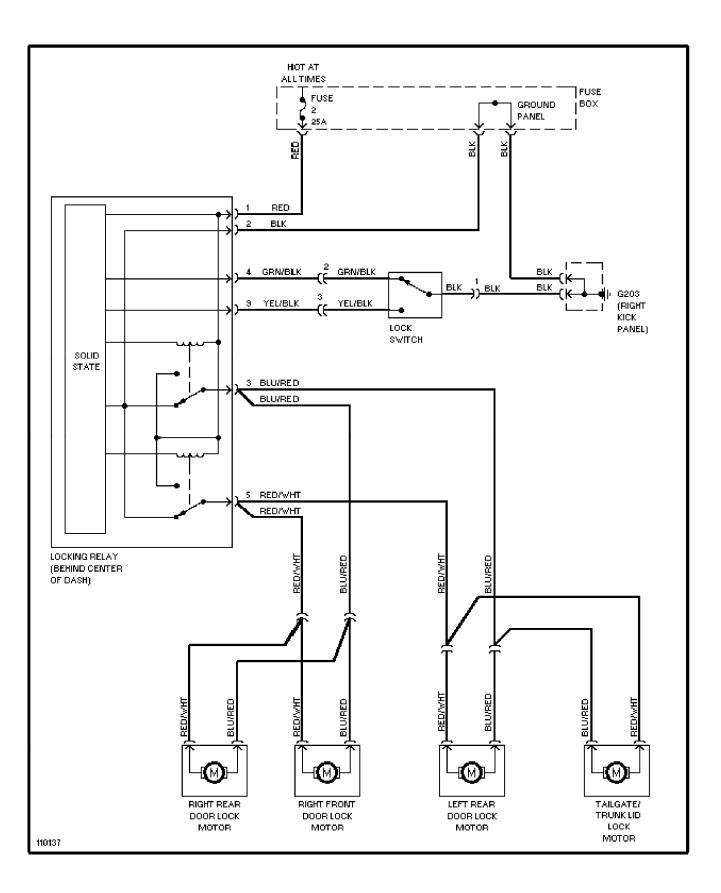


SYSTEM WIRING DIAGRAMS Power Mirror Circuit

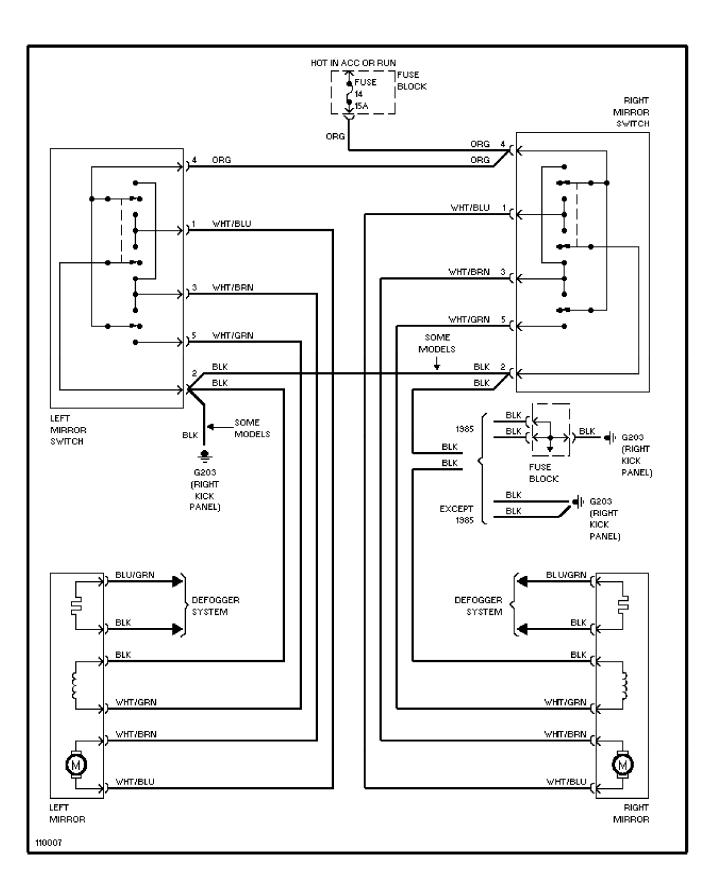


SYSTEM WIRING DIAGRAMS Heated Seats Circuit, Dual Output

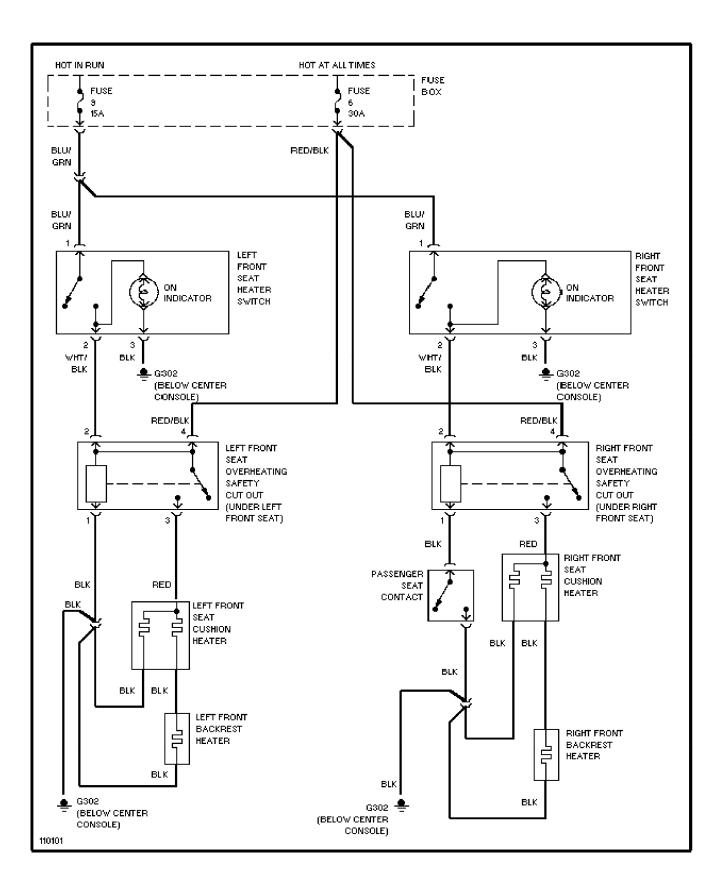


SYSTEM WIRING DIAGRAMS Heated Seats Circuit, Single Output

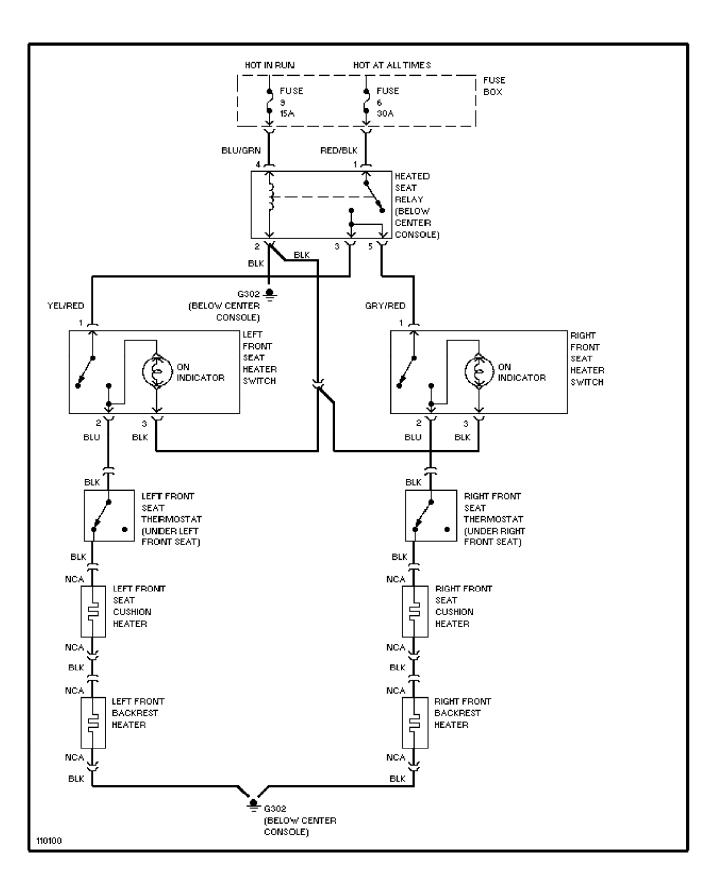


SYSTEM WIRING DIAGRAMS **Power Window Circuit**

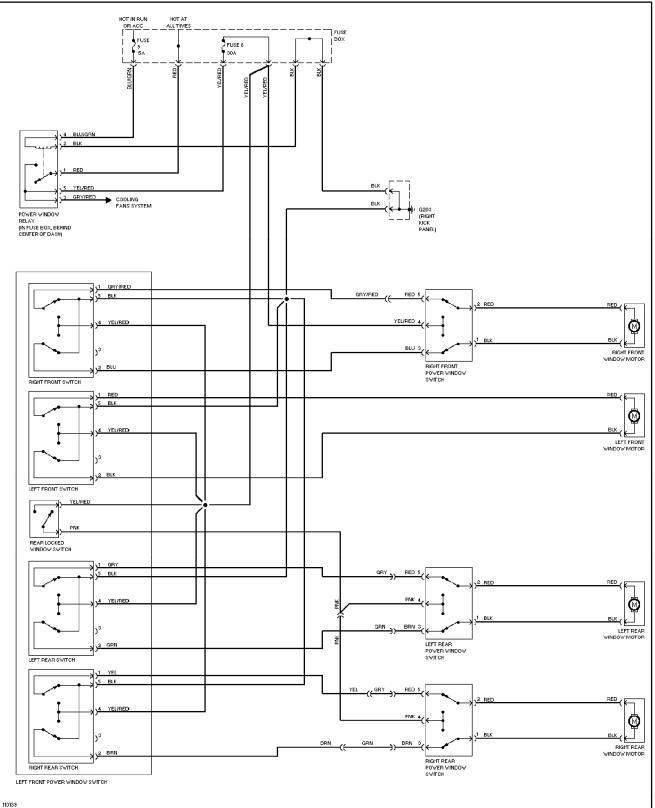

SYSTEM WIRING DIAGRAMS Radio Circuits

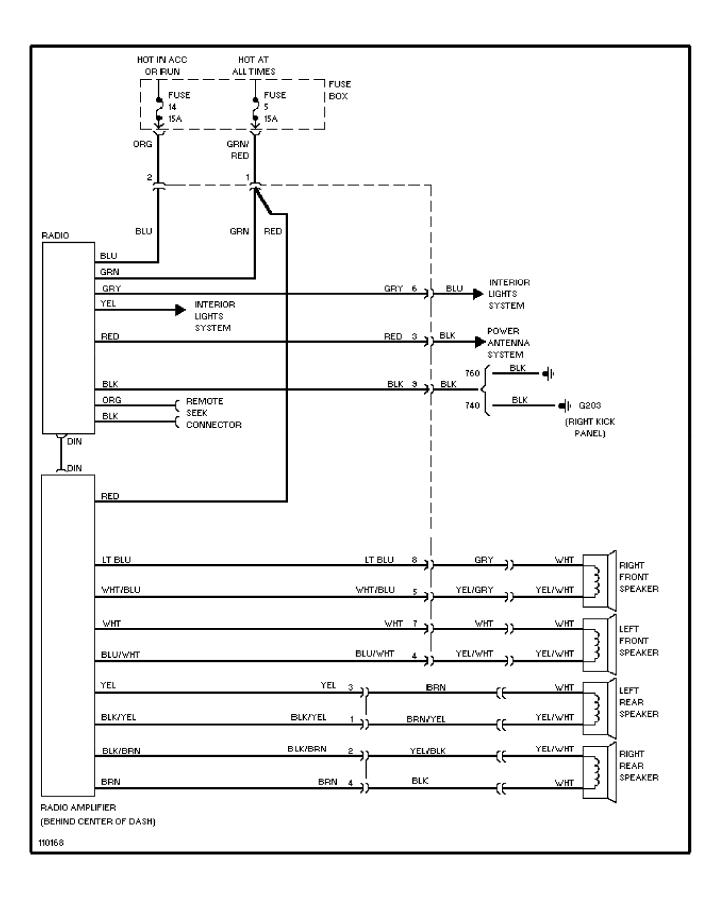

SYSTEM WIRING DIAGRAMS Charging Circuit

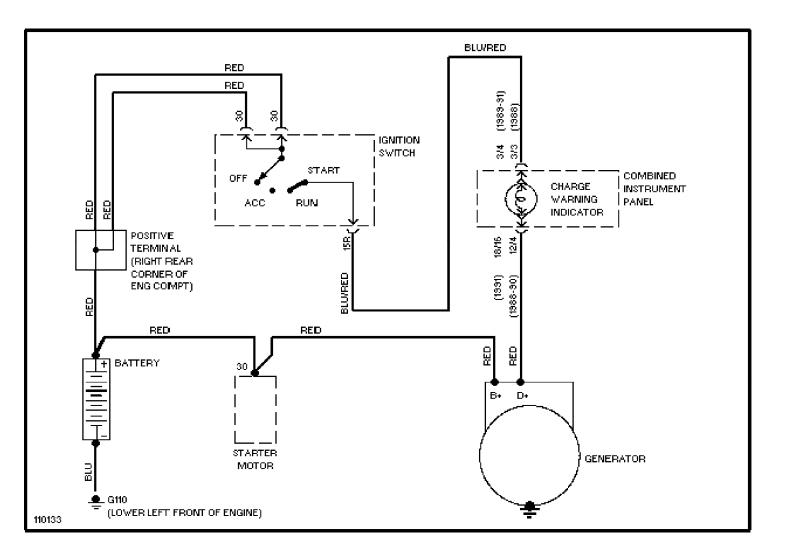

WIRING DIAGRAMS


Fig. 7: Instrument Panel

1988 Volvo 740

For x

Copyright © 1998 Mitchell Repair Information Company, LLC


Friday, July 23, 2004 08:46PM

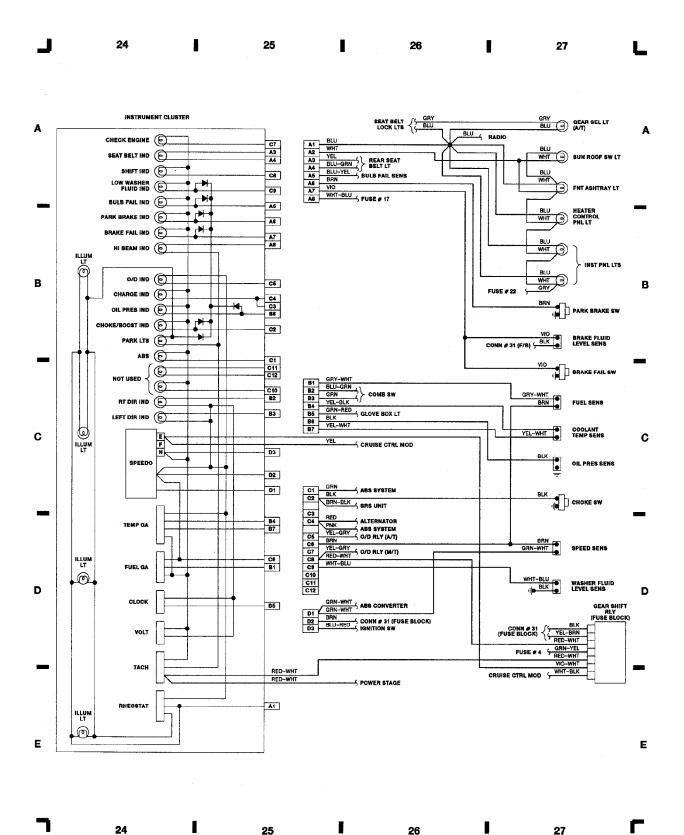

WIRING DIAGRAMS Fig. 8: Accessories (Cont.)


1988 Volvo 740

For x

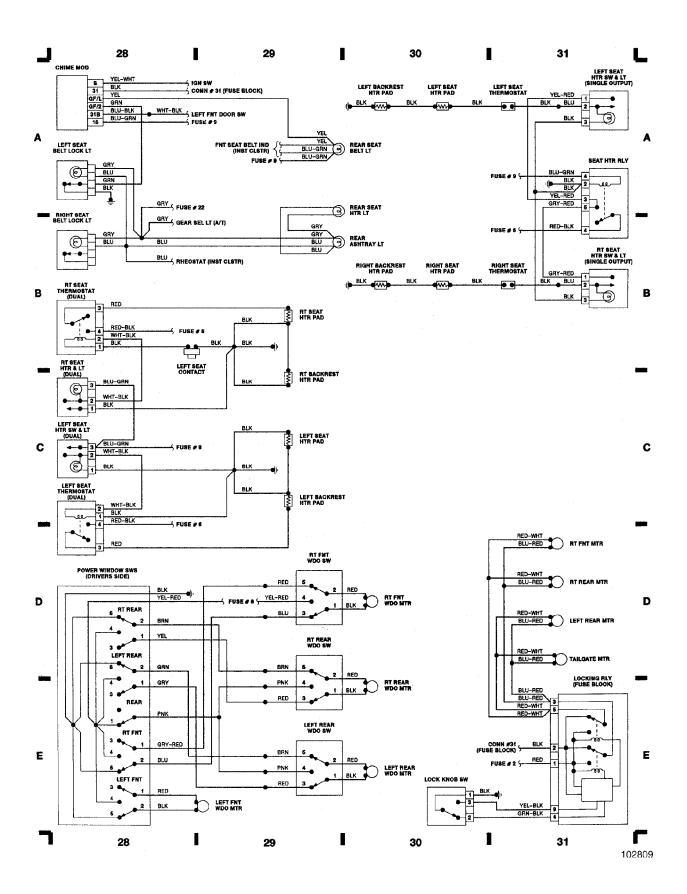


WIRING DIAGRAMS Fig. 9: Passenger Compartment & Taillights 1988 Volvo 740

For x

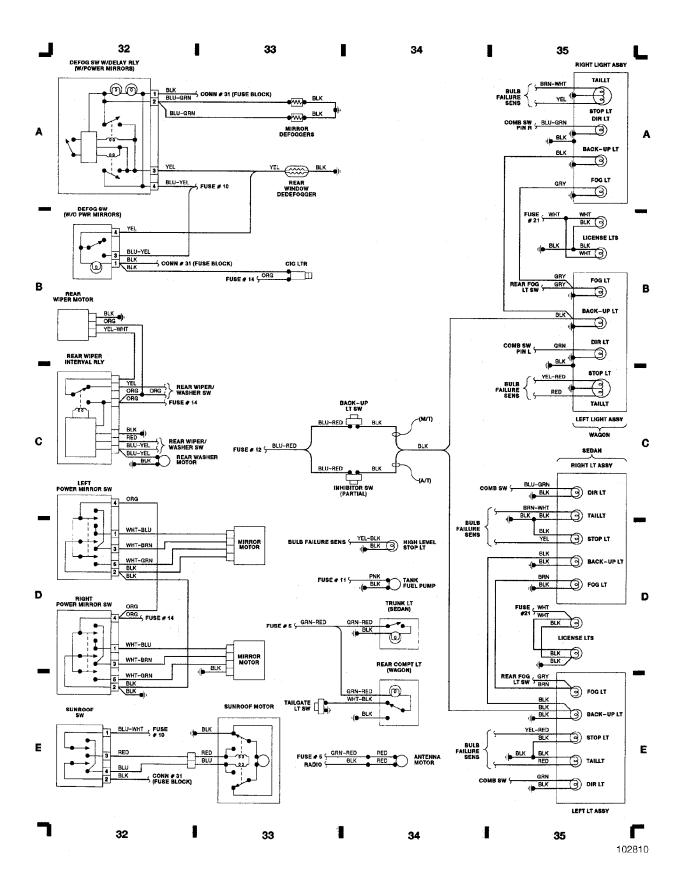

WIRING DIAGRAMS Fig. 1: Engine Compartment & Headlights 1988 Volvo 740

For x

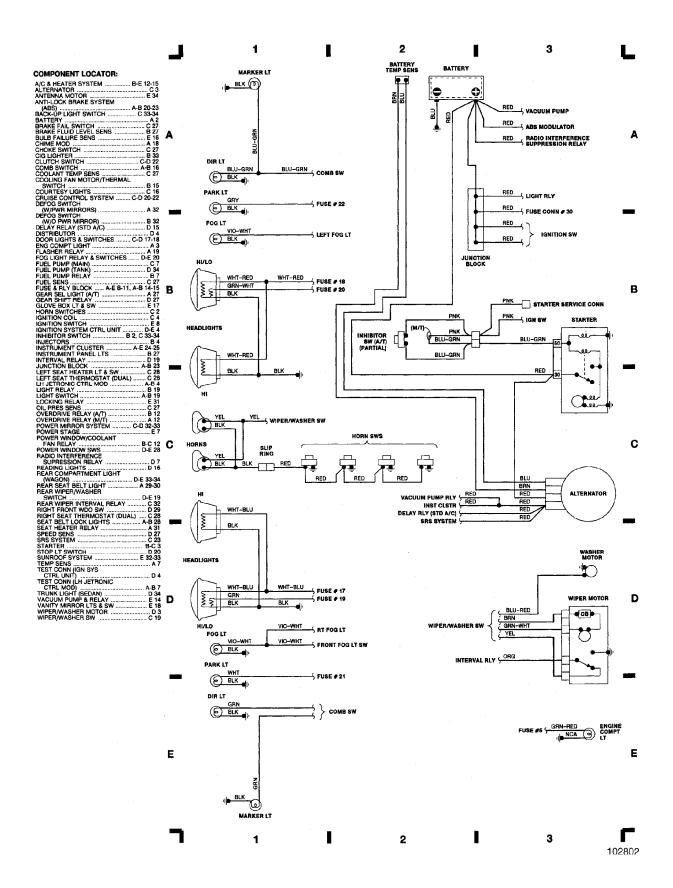


WIRING DIAGRAMS Fig. 2: Computer Engine Control

1988 Volvo 740

For x

Copyright © 1998 Mitchell Repair Information Company, LLC

Friday, July 23, 2004 08:46PM

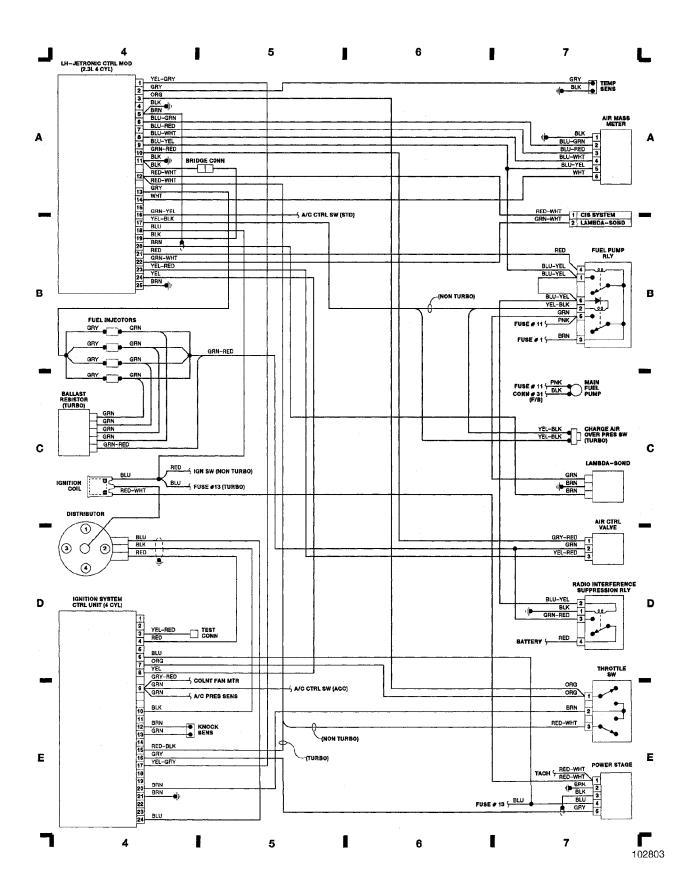

WIRING DIAGRAMS


Fig. 3: Fuse Block

1988 Volvo 740

For x

Copyright © 1998 Mitchell Repair Information Company, LLC



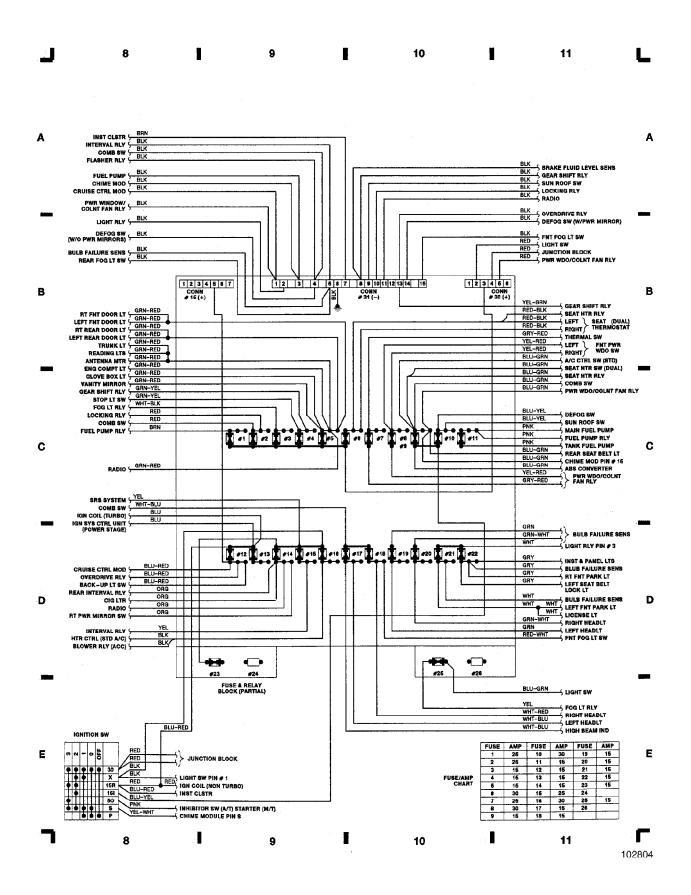


WIRING DIAGRAMS Fig. 4: Relays, Underdash & A/C & Heating 1988 Volvo 740

For x


Copyright © 1998 Mitchell Repair Information Company, LLC

Friday, July 23, 2004 08:46PM

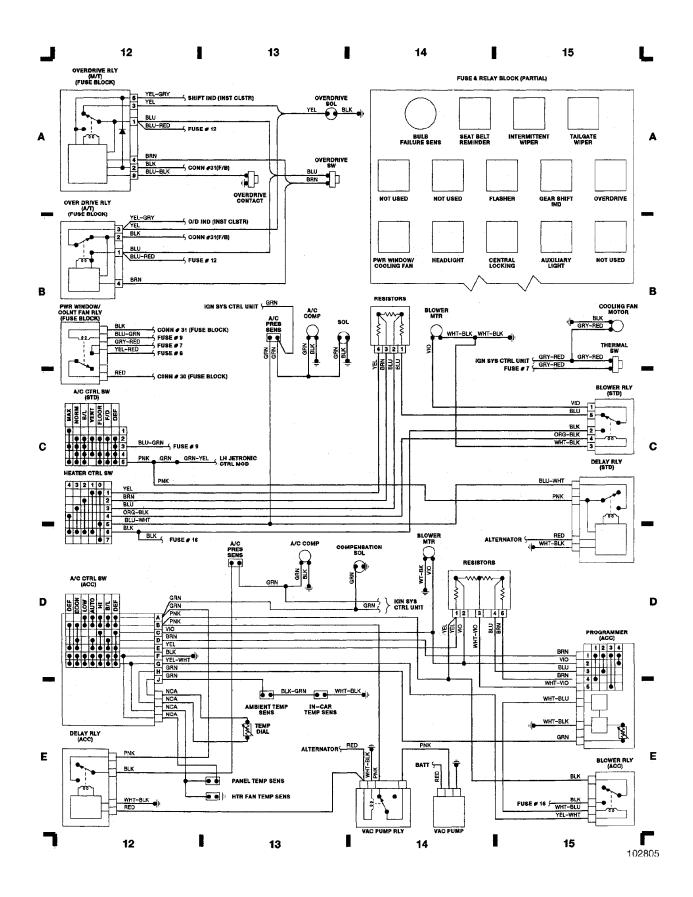

WIRING DIAGRAMS Fig. 5: Steering Column Switches & Accessories 1988 Volvo 740 For x

Copyright © 1998 Mitchell Repair Information Company, LLC Friday, July 23, 2004 08:46PM

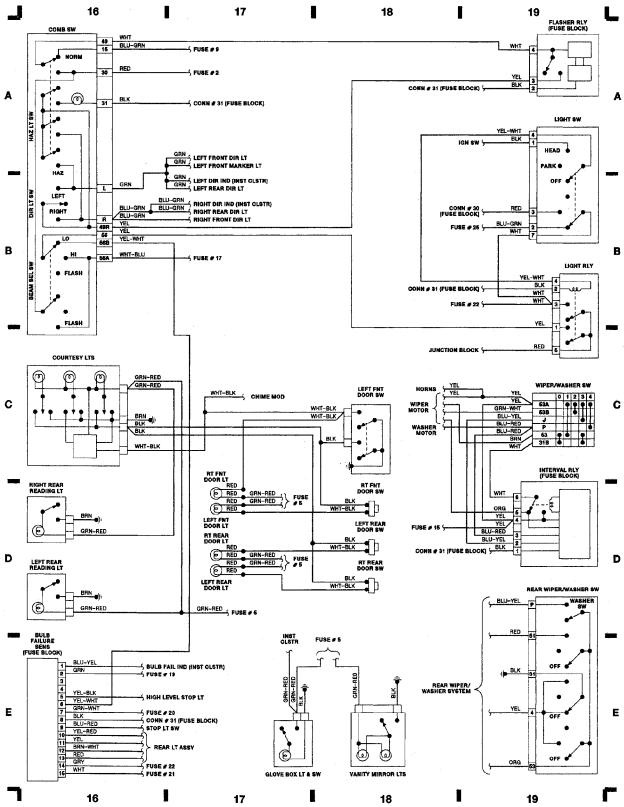


102806

WIRING DIAGRAMS Fig. 6: Anti-Lock Brake System, Cruise Control & Rear Defogger 1988 Volvo 740

For x

Copyright © 1998 Mitchell Repair Information Company, LLC Friday, July 23, 2004 08:46PM

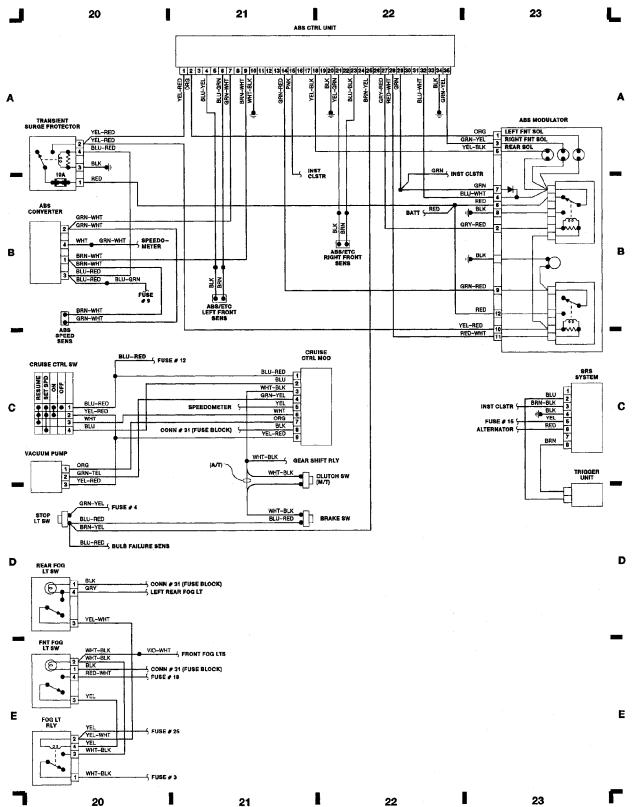

102807